

87406

SOLIHULL, WARWICKSHIRE, England
Telephone No.: Sheldon 4242
Telegrams: Rovrepair, Solihull

Rover Service News Letter No. 95

September, 1958.

TO ALL DISTRIBUTORS AND DEALERS

Dear Sirs,

The changes and developments set out below have taken place during the past month.

With this issue we are including copies of Cumulative Amendment No. 5 to the Master Parts Price List.

SECTION I

POLICY

No items of policy this month.

SECTION II

WORKSHOP AND PARTS INFORMATION

Item 439 SUBJECT: **OIL PRESSURE SWITCH**
MODELS: 1958 '60', '75', '90' and '105'
1958 Land-Rover Petrol and Diesel
MODIFICATION: Access slot in switch sealed with solder to prevent loss of oil in the event of diaphragm failure.
PART NUMBER: Oil pressure switch 1 505152
COMMENCING NUMBERS:
Engines numbered:
'60' All models from 600801488 onwards
'75' All models from 605801416 onwards
'90' All models from 610804136 onwards
'105 R' 8.5 : 1 ratio from 615801163 onwards
'105 R' 7.5 : 1 ratio from 616800458 onwards
'105 S' 8.5 : 1 ratio from 620803296 onwards
'105 S' 7.5 : 1 ratio from 621800331 onwards
2 litre Land-Rover R.H.D. models from 111810270 onwards
2 litre Land-Rover L.H.D. models from 114805056 onwards
2½ litre Land-Rover models from 141805400 onwards
REMARKS: All future Service replacements will be the latest sealed type.

Item 440 SUBJECT: **SILICONE M.S.4 COMPOUND**
MODELS: All
PART NUMBER: Silicone M.S.4 compound 1 270656
REMARKS: We give below one or two additional applications of Silicone M.S.4 compound which may prove of interest to Distributors and Dealers.
(a) Batteries, use in lieu of vaseline on battery terminals; this will prevent the rubber boot becoming soft.
(b) Body, apply very lightly to outside edge of door sealing rubbers, to prevent any tendency to squeak should there be any relative movement between door and sealing rubber.

Yours faithfully,
for THE ROVER COMPANY LIMITED,

M. Brewer.

Publications Editor,
Technical Service Department.