



Service Department:

THE ROVER COMPANY LIMITED

SOLIHULL
WARWICKSHIRE
ENGLAND

LAND-ROVER SERVICE NEWS LETTER
No. 12

July 1961

Item 65 SUBJECT: GEAR CHANGE LEVER

MODELS: Land-Rover Series II.

PART NUMBERS:	Gear change lever assembly	1	509939
	Gear change lever	1	509386
	Vulkollan "O" ring for gear lever	1	509233

MODIFICATION: To prevent any tendency for the gear lever to rattle by the addition of a Vulkollan "O" ring inserted into the gear lever ball end.

COMMENCING NUMBERS:

- Vehicles numbered:
- 88 Home R.H.D. Petrol models from 141100981 onwards
 - 88 Export R.H.D. Petrol models from 142100516 onwards
 - 88 Export L.H.D. Petrol models from 144101022 onwards
 - 88 Home R.H.D. Diesel models from 146100410 onwards
 - 88 Export R.H.D. Diesel models from 147100061 onwards
 - 88 Export L.H.D. Diesel models from 149100116 onwards
 - 109 Home R.H.D. Petrol models from 151100400 onwards
 - 109 Export R.H.D. Petrol models from 152101074 onwards
 - 109 Export L.H.D. Petrol models from 154100421 onwards
 - 109 Home R.H.D. Diesel models from 156100264 onwards
 - 109 Export R.H.D. Diesel models from 157100124 onwards
 - 109 Export L.H.D. Diesel models from 159100099 onwards

REMARKS: Earlier Series II models can be modified by fitting either the complete gear change lever under part number 509939 or by using the lever 509386, together with the "O" ring 509233. It is not a practical proposition to modify an existing gear lever to enable the "O" ring to be fitted.

Item 66 SUBJECT: RADIATOR FILLER CAP

MODELS: Land-Rover Series II Diesel.

MODIFICATION: Introduction of a re-designed filler cap which operates at a pressure of 9 lb. per sq. in. (0,6 kg/cm²).

PART NUMBERS:	Filler cap for radiator	1	509767
	Retaining chain for cap	1	509769

REMARKS: The radiator caps, which can be identified by the figure 9 or 10 as the case may be, representing 9 lb. per sq.in. (0,6 kg/cm²) and 10 lb. per sq.in. (0,7 kg/cm²) are not interchangeable, and both types must be serviced.