

o.g. Boles

Rev. d. 8/12/66 - H.A.



Service Department:

THE ROVER COMPANY LIMITED

By Appointment to
Her Majesty
Queen Elizabeth II



Manufacturers
of Motor Cars and
Land-Rovers

SOLIHULL
WARWICKSHIRE
ENGLAND

LAND-ROVER SERVICE NEWS LETTER Vol. 2 No. 15

December 1966

Item 60 SUBJECT: REPLACEMENT PARTS (Policy item)

MODEL: Land-Rover.

REMARKS: Spare parts, which are not of Rover origin and do not carry the Rover Company's approval, are found to be offered to the trade, sometimes at a lower cost, as being suitable for Rover products. It is of utmost importance that only genuine Rover spares or parts approved by the Rover Company are supplied and fitted, to ensure the requisite performance and maintain the full validity of the warranty.

Item 61 SUBJECT: REAR AXLE

MODEL: Land-Rover 88 in.

REMARKS: The '241' range of rear axle serial numbers applicable to the Land-Rover 88 in. has now been completely used up: the rear axle serial numbers for these models have therefore been changed to the '243' range.

The new range of serial numbers will commence with the number 24300001B.

Item 62 SUBJECT: AXLE CASING

MODEL: Land-Rover.

MODIFICATION: Deletion of dowel locating the differential housing in the front and rear axle casings.

LITERATURE
AFFECTED: Land-Rover Parts Catalogue, Part No. 4656. Page 187.
Forward Control Parts Catalogue, Part No. 4517. Page 103.

PART NUMBER: Dowel, locating differential housing 2 55705

REMARKS: The locating dowels for the differential on the front and rear axles have been deleted, as the bolts afford an adequate location. At the same time the locating holes for the dowels in the differential housing have also been deleted.

When fitting a latest-type differential unit to earlier axles, it is therefore necessary to remove the dowels from the axle casing.

Item 63 SUBJECT: LAMPS

MODELS: Land-Rover Series II and IIA.

MODIFICATION: Introduction of wire mesh guard for the protection of side, stop and flasher lamps.

LITERATURE AFFECTED: Land-Rover Optional Equipment Parts Catalogue, Part No. 4705. Page 244.

PART NUMBERS:	Wire mesh guard for side, stop, tail and flasher lamps	4	320626
	Screw (2 BA x ½ in. long)		8	77869
	Plain washer	} Fixing guard to front wings or rear body	8	3816
	Spring washer		8	3073
	Nut (2 BA)		8	3823

REMARKS: The above wire mesh guard and fixings are now available from our Parts Department. The guard can be fitted to all Series II and IIA vehicles, but they cannot be used on the front wings when jerrican holders are fitted.

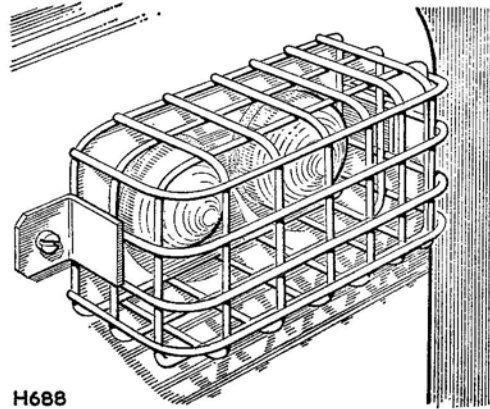


Fig. 1. Wire mesh guard, front illustrated.

Item 64 SUBJECT: FREE-WHEELING HUBS

MODEL: Land-Rover.

LITERATURE AFFECTED: Land-Rover Workshop Manual, Part No. 4611, Page F-15.

REMARKS: To ensure adequate lubrication of the top Railko bushes on Land-Rovers fitted with free-wheeling hubs, it is necessary to engage these hubs from time to time.