



Service Department:

THE ROVER COMPANY LIMITED

By Appointment to
Her Majesty
Queen Elizabeth II



Manufacturers
of Motor Cars and
Land-Rovers

SOLIHULL
WARWICKSHIRE
ENGLAND

LAND-ROVER SERVICE NEWS LETTER Vol. 2 No. 16

January 1967

Item 65 SUBJECT: PRICE LIST (Policy Item)

LITERATURE AFFECTED: Rover Master Parts Price List, 20th Edition, Part No. 4157.

REMARKS: We have been notified of a number of Lucas price changes authorised by the Ministry of Technology and effective from January 1st, 1967.

These changes will appear in Supplement No. 7 to the Rover Master Parts Price List to be issued in February 1967. In the meantime the changes, as applicable, will be incorporated on our Invoices.

Item 66 SUBJECT: CLUTCH

MODELS: Land-Rover 88 and 109 Diesel.

LITERATURE AFFECTED: Land-Rover Parts Catalogue, Part No. 4656. Page 161.

PART NUMBER: Clutch plate, Borg and Beck 47626/67 1 601294

COMMENCING NUMBER: From engine number 27134792G onwards.

REMARKS: The new clutch plate is fitted as standard equipment to all 88 and 109 Diesel Land-Rovers. It comprises strengthened torque reaction springs to prevent centre hub failure due to spring breakages. The above clutch plate, which can be identified by the dark grey and light green coloured springs, is completely interchangeable with the earlier type and can be used as a replacement on all 2½ litre Diesel Land-Rovers.

Item 67 SUBJECT: SELECTOR LEVERS

MODEL: 109 Land-Rover Forward Control, Series IIA.

LITERATURE AFFECTED: Land-Rover Workshop Manual, English, Part No. 4611, supplement covering Forward Control models. Page 19.

REMARKS: Occasional difficulties have been experienced in clamping the selector levers rigidly to their respective selector rods.
Where the clamping action is found to be insufficient, the grip can be increased by cutting a slot $\frac{1}{16}$ in. (1,5 mm) wide and $\frac{5}{32}$ in. (4,0 mm) deep in the lever, directly opposite the saw cut. If possible the slot should have radiused corners.

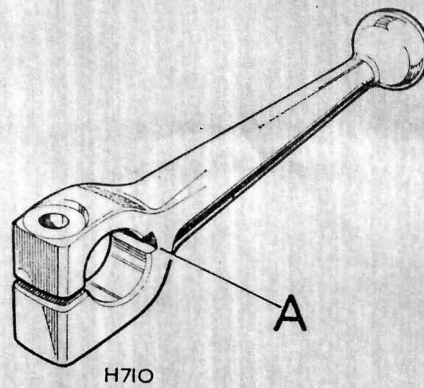


Fig. 1 Modification to gearchange selector levers
 A—Slot $\frac{1}{8}$ in. (1.5m.m.) x $\frac{5}{32}$ in. (4,0 m.m.)

Item 68 SUBJECT: JERRICAN KIT

MODELS: Land-Rover, Series II and IIA.

LITERATURE AFFECTED: Land-Rover Optional Equipment Parts Catalogue, Part No. 4705. Page 246.

PART NUMBER: Jerrican and fixing kit 1 320615

REMARKS: The $4\frac{1}{2}$ gallon (20 litre) capacity jerricans are designed to be fitted to the front of the front wings by means of a holder and stiffener. The existing side lamps must be removed and the new side lamps fitted on top of the wings. Where flasher lamps are fitted, these must also be repositioned on top of the wings, adjacent to the side lamps.

The service kit, comprising two jerricans and fixings, is available from our Parts Department; these kits are complete with a Fitting Instruction. This latter is available in English only.